

# MONUMENT RECORD

Corner ID: **Wash\_I03**

## Quarter Corner

Sections 4 & 5- T10N-R01W, 2nd P.M.

Washington Township, Monroe County, Indiana




Section 05  
T10N-R01W

Section 04  
T10N-R01W

**MONUMENT:** Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)

(#351) Peak on top of wedge-shaped Limestone 0.6' above ground, 0.2' West of found 5/8" rebar. Stone was initially found lying over and buried, with peak facing West and the base of the Stone near the 5/8" rebar. The Stone is 0.7' wide at its base, 1.3' long and 0.2' thick. The dirt at the west base of the rebar seemed loose, giving the impression this is where the stone had been rooted before becoming dislodged and since 1993 records by Michael Friley cite "Stone with rebar adjacent", it is evident, in my opinion this is where the stone had been, Also old ribbon was uncovered deep in the hole while digging. A 5/8" rebar was driven against the West (downhill) side of the Stone this survey.

### MONUMENT LOCATION SKETCH:

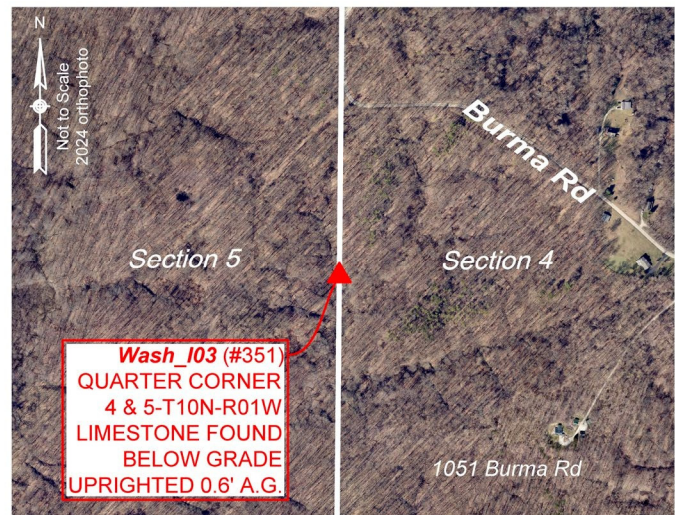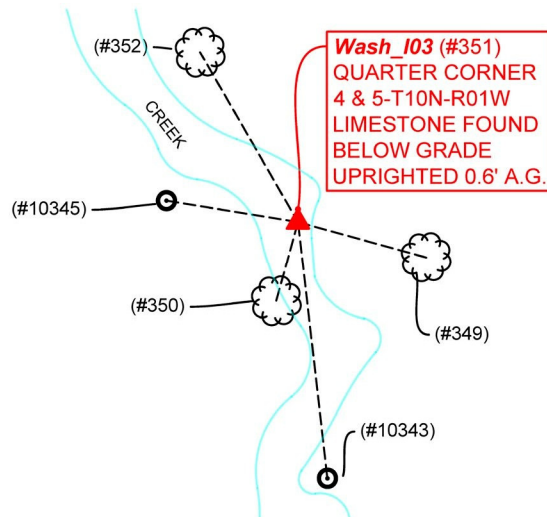

**WITNESS MONUMENT TIES:** Describe at least three new BT's (Bearing Trees) and/or witness objects established or work done to preserve existing evidence. BT diameters are noted as dbh (diameter at breast height) and are measured approximately 4.5' above ground. Bearings and Distances are measured from the monument to the center of the BT. Bearings and Distances to witness ties were measured with a Sokkia Set 510 Total Station.

ID	Bearing	Distance	Description
(#349)	S74° 31'E	20.8'	17" diameter Shagbark Hickory tree
(#350)	S15° 16'W	12.8'	9" diameter Sugar Maple tree on creek bank
(#352)	N30° 01'W	30.5'	16" diameter Shagbark Hickory tree

### MONUMENT ACCESSORIES

Other survey grade monuments that were located in the vicinity and their relation to the monument. Witnesses noted as a Rebar Lite are a 5/8" diameter by 16" polycarbonate rod with a 1-1/2" mag nail in top and yellow plastic cap stamped "MONROE COUNTY WITNESS POINT" set 0.1 foot below grade unless otherwise noted.

Geodetic coordinates in this table are provided in the format Northing, Easting

(#10343)	S06° 37' 38"E	40.19'	N:1487710.0358' E:3107313.8709 ' Rebar Lite
(#10345)	N80° 44' 10"W	20.79'	N:3107288.7187' E:3107288.7187': Rebar Lite



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 1 of 4

# MONUMENT RECORD

Corner ID: **Wash\_I03**

## Quarter Corner

Sections 4 & 5- T10N-R01W, 2nd P.M.  
Washington Township, Monroe County, Indiana


Section 05  
T10N-R01W

Section 04  
T10N-R01W

**PHOTO IDENTIFIED:** Photo Date: 08/22/2025



Photo Orientation & Description: From Northeast looking Southwest



Photo Orientation & Description: From North looking South

**EXISTING SURVEY HISTORY** Include as much detail and history of the corner as known at the time of perpetuation

### ORIGINAL GOVERNMENT SURVEY:

Year Surveyed: 1819 By: Thos Brown

Where filed or recorded: Monroe County Original notes page 132

Original monument: Post

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Beech	21"	N24°W	5 links
Ash	3"	S11°E	40 links

Notes:

### SUBSEQUENT CORNER RESTORATION:

Date Surveyed: April 1882 By: George Radar Deputy Monroe County Surveyor

Where filed or recorded: Legal Survey Book 2, pages 365 & 366

Original monument: Not noted

Bearing Trees or Reference Monuments:

Species	Dia.	Bearing	Distance
Red Oak	1 ½"	S26°W	18 lks
Hickory	3"	S59°E	11 ¾ lks

Notes:

**SUBSEQUENT CORNER RESTORATION:** None found in legal survey books.

**OTHER SURVEY HISTORY:** Include details such as surveyor name, date, recording info, monument description, etc.

DocumentDate	SurveyID	Surveyor	Description	InstrumentNo
7/8/1987	RSID005782	Vollmer, Robert C.	Department of Natural Resources, Morgan-Monroe State Forest Survey	
5/29/1990	RSID005159	Graham, Raymond	""Stoynebis"" appears to be the name in the middle of the property."	
11/12/1996	RSID005804	Bledsoe, Ben E.	Survey of Part Nw 1/4 S4-10N-1W	
1/10/2000	RSID005802	Archer, Steven W.	Survey of NW 1/4 NW 1/4 S4-10N-1W	
6/9/2000	RSID005803	Vollmer, Robert C.	Morgan/Monroe Line Survey	

**ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND BY THE MONROE COUNTY SURVEYORS OFFICE:** Include, search area or areas, search procedure, etc.

Date of Field work/Search: 07/21/2000 By: Kevin Enright, Mike Barber & Kurt Babcock Monument Found: Rebar. BTs or Reference Objects Found: References established Project #: Washington I03 Field Book: 33 page 5 Notes:

**ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND BY THE MONROE COUNTY SURVEYORS OFFICE:** Include, search area or areas, search procedure, etc.

Date of Field work/Search: 08/22/2025 By: MES/JMG/EGC Monument Found: Stone (stood back up beside rebar) BTs or Reference Objects Found: From prior MCSO project yes. Project #25-003 Field Book: 59 pages 3 & 4 Notes:



**OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph**

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us


Page 2 of 4

# MONUMENT RECORD

Corner ID: **Wash\_I03**

## Quarter Corner

Sections 4 & 5- T10N-R01W, 2nd P.M.  
Washington Township, Monroe County, Indiana

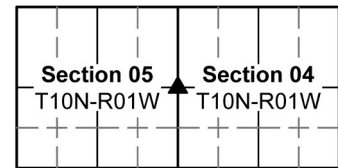

**OTHER EVIDENCE:** *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

There are no distinctive visible occupation lines in the area. The corner is deep in the woods, we reached it by parking at a pull off on Burma road where said road diverts from the West line of Section 4 and walking generally South to the corner.

**MONUMENT PRESERVATION:** *Describe work done to preserve existing monument.*

GPS coordinates were established on the Stone. 2 rebar lites were set within sight of it, that could be used to reestablish its location, should it become obliterated. We also located trees, for visual reference. A steel post with Monroe County Survey marker sign attached (currently under a fallen ash tree) was observed on the South side of the Stone. Besides the 5/8" rebar found against the East side of the stone, another 5/8" rebar was driven this survey against the West side of the Stone to help shore it up.

**THEORY OF LOCATION:** *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.*

The stone was found and is presumed to be the monument set by George Radar Deputy Monroe County Surveyor in April 1882, documented in Legal Survey Book 2, pages 365 & 366. Though I found no documented theory of location in how Mr. Radar came up with this location being where the original post was set in 1819, I could not see where there could be any more reliable evidence of its original location and therefore consider the stone the most reliable evidence of the corner's original location with negligible uncertainty.

**GEODETIC COORDINATES:** *Northing: 1487750.0', Easting: 3107309.2'*

### BASIS OF GEODETIC COORDINATES:

The basis of bearings is Grid North NAD83(2011), Indiana West Zone, Epoch 2010.0000, Geoid Model G2012BU7, Datum NAD83\_NO\_TRANS, US Survey Feet, derived from GPS observations utilizing the Indiana Real-Time Network (INCORS). Coordinate data was collected with a Javad Triumph LS Network Rover and/or with a Sokkia Set 510 Total Station radially from points located with GPS. Distances obtained with GPS have not been adjusted to ground. To adjust grid distances to ground distances multiply them by a scale factor of 1.000035974.

This document is not complete without the associated Corner Perpetuation plat and report of survey for Section 4 or 5 Township 10 North Range 1 West by Michael E. Sheppard of the Monroe County Surveyor's Office.



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyorsoffice@co.monroe.in.us

Page 3 of 4



# MONUMENT RECORD

Corner ID: **Wash\_I03**

**Quarter Corner**

Sections 4 & 5- T10N-R01W, 2nd P.M.

Washington Township, Monroe County, Indiana


Section 05  
T10N-R01W

Section 04  
T10N-R01W

## CERTIFICATIONS:



*Michael E. Sheppard*

Date: 2/17/2026

Michael E. Sheppard

State of Indiana

Professional Surveyor

No. 20100021



*Trohn Enright-Randolph*

Date: 2/17/2026

Trohn Enright-Randolph

Monroe County Surveyor



*Donna K. Kish*

Accepted by the Monroe County  
Surveyor Review Board on

2/17/2026



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

501 N Morton Street Ste 205, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 4 of 4

# MONUMENT RECORD


Corner I.D. #

I-3

STATE OF INDIANA - COUNTY OF MONROE

Section Five (5), Township 10 North, Range 1 West

Monument Description & Remarks: Stone (top half broken) found, 0.55' x  
0.16' x 0.7' exposed with rebar adjacent, at SE Corner of SE 1/4 of NE 1/4.  
Corner witnessed 2/5/87. (Stone & rebar fence-staked.)

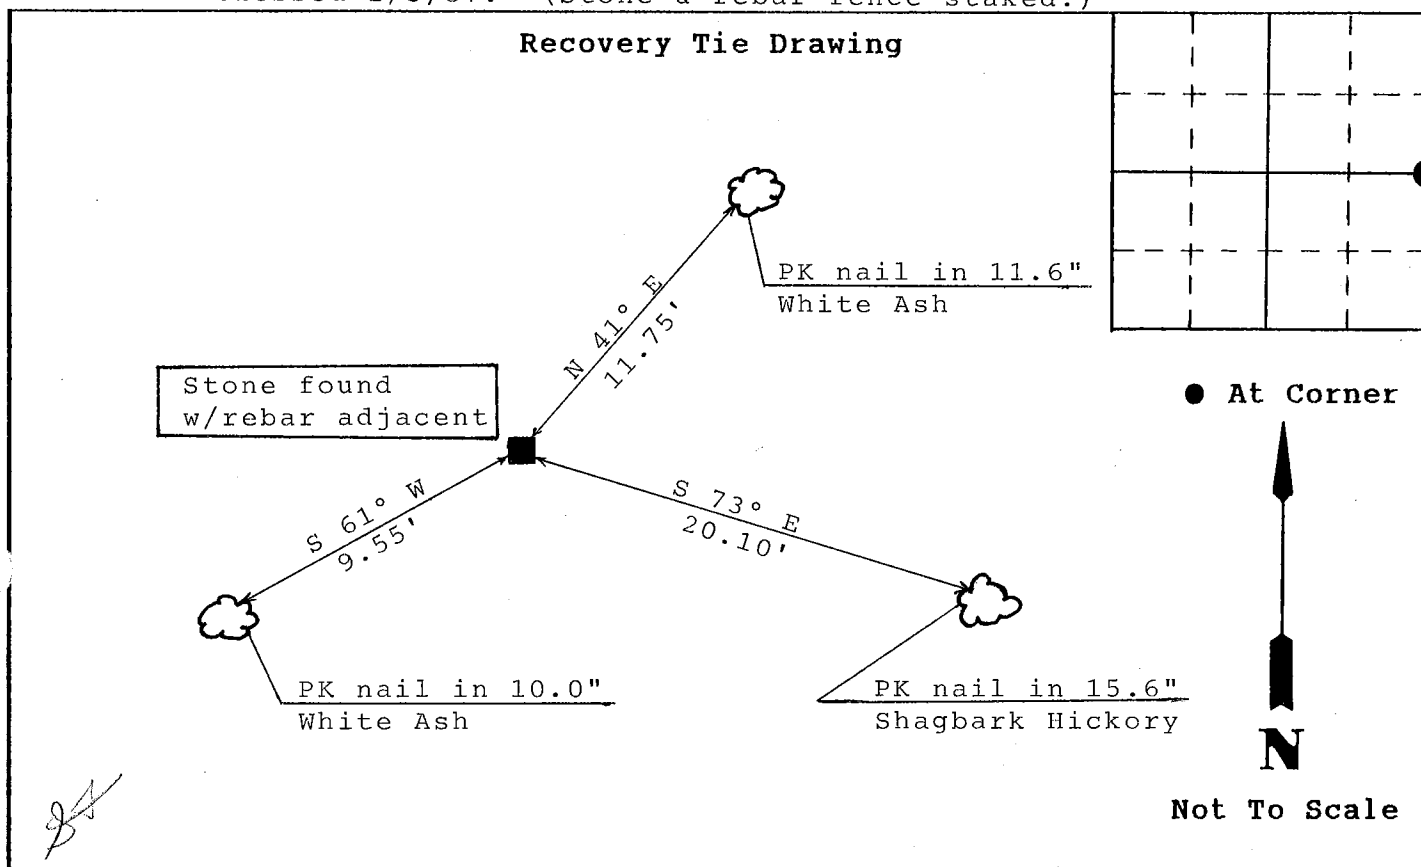

State of Indiana

County of Monroe

I, Michael W. Friley, County Surveyor, hereby certify  
that this document was prepared under my direction in  
accordance with the provisions of Section 17-3-64-4  
through 17-3-64-8 of the Indiana Code, being Acts of 1965,  
Chapter 319; and the above data is given under my hand and  
seal this 6th day of October, 1993 A.D.

Space  
Reserved For  
Recording  
Officer

Indiana Registered Land Surveyor No. \_\_\_\_\_ or

Morgan-Monroe State Forest  
United States Government Agency

David C. Vadas, Timber Specialist  
Title

Field Book:

n/a

Page:

n/a